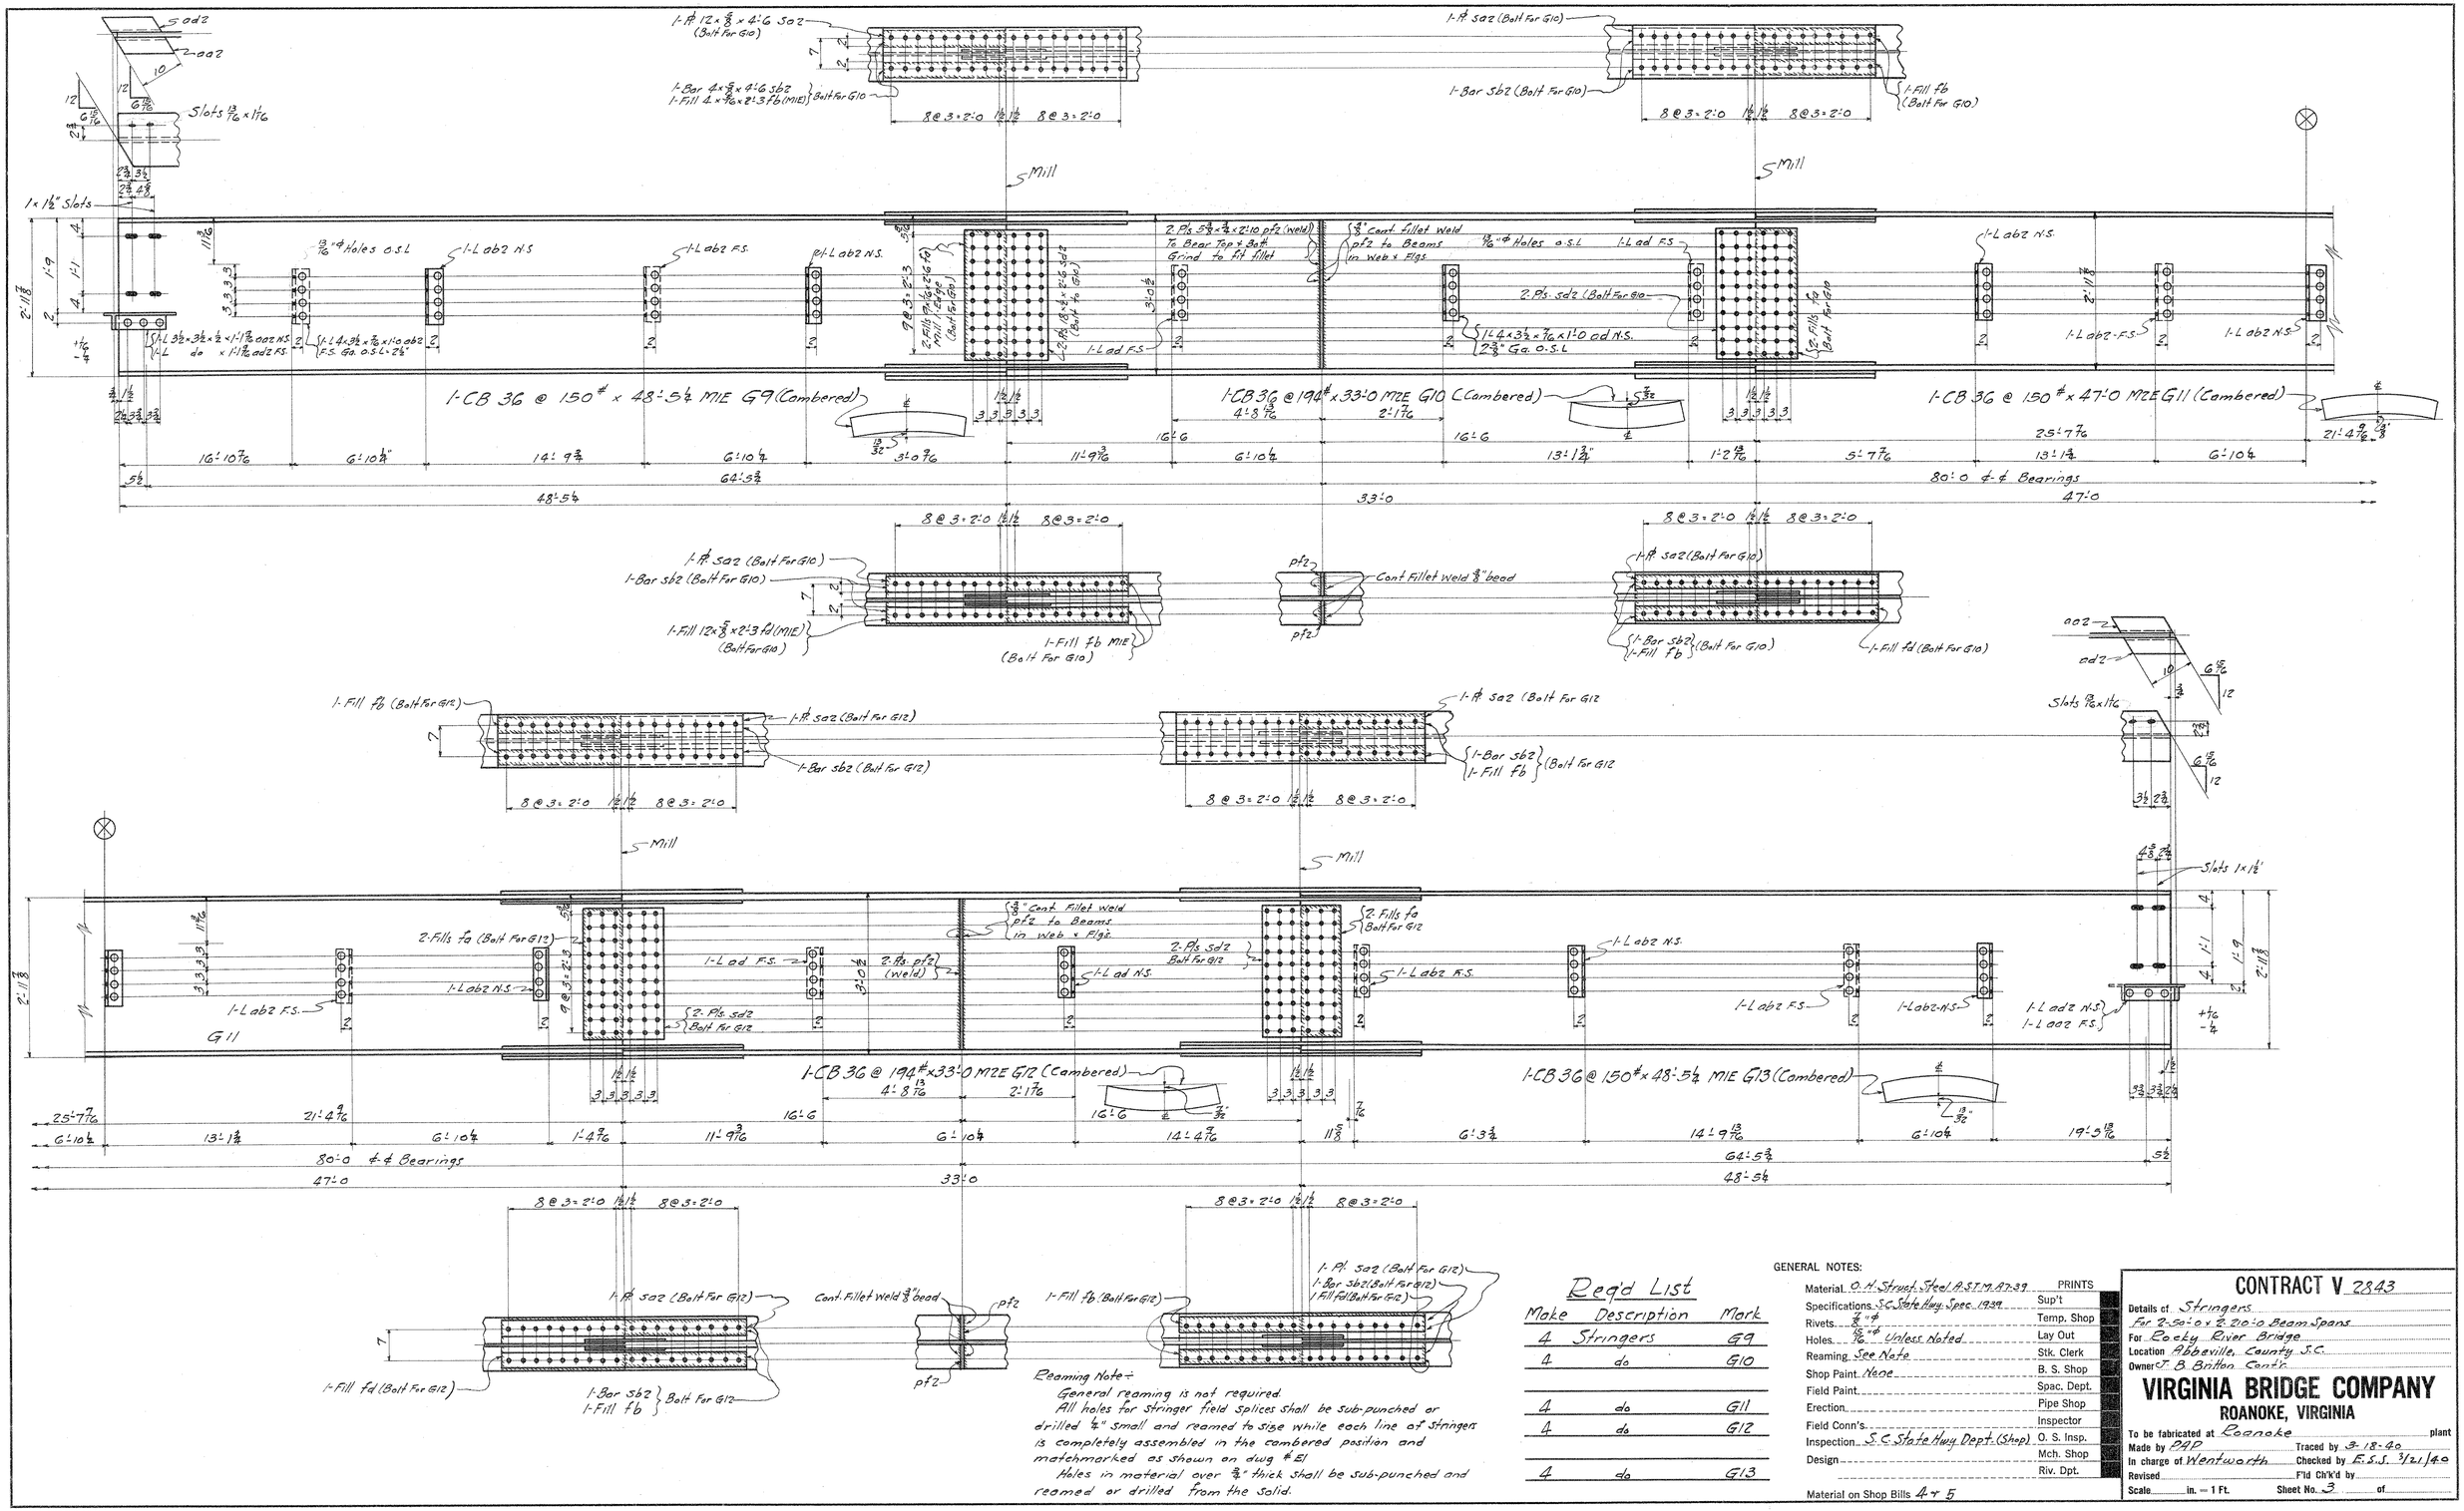

Reqd List

Make	Description	Mark
4	Stringers	G9
4	do	G10
4	do	G11
4	do	G12
4	do	G13

Reaming Note:
General reaming is not required.
All holes for stringer field splices shall be sub-punched or drilled ¼" small and reamed to size while each line of stringers is completely assembled in the cambered position and matchmarked as shown on dwg # E1.
Holes in material over ¾" thick shall be sub-punched and reamed or drilled from the solid.

GENERAL NOTES:

Material O.H. Struct. Steel A.S.T.M. A7-39
Specifications S.C. State Hwy. Spec. 1939
Rivets ⅞" ø
Holes ⅞" ø Unless Noted
Reaming See Note
Shop Paint None
Field Paint
Erection
Field Conn's.
Inspection S.C. State Hwy. Dept. (Shop)
Design

PRINTS: Sup't, Temp. Shop, Lay Out, Stk. Clerk, B. S. Shop, Spac. Dept., Pipe Shop, Inspector, O. S. Insp., Mch. Shop, Riv. Dpt.

Material on Shop Bills 4 & 5

CONTRACT V 2843

Details of Stringers
For 2-50'-0 x 2-10'-0 Beam Spans
For Rocky River Bridge
Location Abbeville, County S.C.
Owner J. B. Britton, Cont'r.

VIRGINIA BRIDGE COMPANY
ROANOKE, VIRGINIA

To be fabricated at Roanoke plant
Made by PAP Traced by 3-18-40
In charge of Wentworth Checked by E.S.S. 3/21/40
Revised F'ld Ch'k'd by
Scale in. = 1 Ft. Sheet No. 3 of